

Project Data	
Location Code:	113
Address:	345 East Parkway
Year Built:	1930
Grade Configuration:	6-8
Baseline Enrollment: (current enrollment	250
excluding CDC and Pre-K)	
Ideal Capacity:	770
Programmatic Capacity:	425(w/o Portables)
Size:	8.73 acres
Portables:	0
Building & Addition	95,345

Description: Existing floor tile contains Asbestos and is in poor condition	
Timeline:	Cost:
TBD	\$215,000

#### **Description:**

Same as previous item



Description:	
Existing lockers have been damaged and need painting	
Timeline:	Cost:
TBD	\$40,000

Description:	
See previous item.	

Description: Asbestos insulation on piping in tunnels.	
Timeline:	Cost:
TBD	\$7,000

<b>Description:</b> Gym bleachers are old and in poor condition	
Timeline:	Cost:
TBD	\$90,000

Description: Washing machine doesn't work / inoperable.	
Timeline:	Cost:
TBD	\$12,000
Description: Ceiling tile glue spots are exposed from missing ceiling tile, some mold is forming.	Cost:

Timeline:	Cost:
TBD.	\$400,000



FAIRVIEW MIL	<b>JDL</b> E
<b>Description:</b> Auditorium chairs are in poor condition and damaged	
Timeline:	Cost:
TBD	\$86,000
Description: Same as previous item	

<b>Description:</b> Plaster walls are damaged in several areas.	
Timeline:	Cost:
TBD	\$12,000

# Description: See previous item.

<b>Description:</b> Kitchen hood does not have a fire suppression system.	
Timeline:	Cost:
TBD	\$6,000

<b>Description:</b> Dishwasher doesn't work.	
	B
Timeline:	Cost:
TBD	\$12,000

Description: Kitchen equipment old and not functioning properly.	
Timeline:	Cost:
TBD	\$30,000
Description:	



Description: PVC Single Ply 12 years-fair Built up gravel roof: 30 years-poor Built up modified roof: 25 years-poor	
Timeline:	Cost:
TBD	\$307,500