

CUSTOMER NAME: Shelby County Schools
BUILDING NAME: Booker T Washington
BUILDING ADDRESS: 715 S Lauderdale St
INSPECTION TYPE: Fire Alarm v2
FREQUENCY: Annual
WORK ORDER: 58737840
INSPECTION START DATE: 06/05/2025
INSPECTION END DATE: 07/07/2025

INSPECTOR: Cameron Peterson
INSPECTOR LICENSE: 56217
ACCOUNT NAME: Johnson Controls North America
OFFICE ADDRESS: 6423 Shelby view Dr
OFFICE PHONE: 901502-2334
OFFICE LICENSE:
TIMEZONE: GMT-05:00

FIRE ALARM INSPECTION REPORT

GENERAL DEFICIENCIES

DESCRIPTION	IMAGES
5 Existing troubles on panel. Trouble smoke photo, second floor south hall 2D067 Trouble First floor south Hall West smoke stair 109A 1D008 Trouble supervisory duct HEND supply dirty 1D109 Trouble smoke beam atrium smoke beam 2D082 Trouble smoke first floor Café entry. 1D023	GENERAL DEFICIENCY IMAGES APPENDIX 1
Duct detector seen by CR V250 dangling from ceiling. Existing issue.	GENERAL DEFICIENCY IMAGES APPENDIX 2
Smoke detector D008 failed at testing. Additionally this device shows no activity at light.	GENERAL DEFICIENCY IMAGES APPENDIX 3
Smoke detector D067 failed at testing. Additionally the device shows no activity at the light.	GENERAL DEFICIENCY IMAGES APPENDIX 4
Tested one water flow and one tamper switch per customer request, both failed to report to FACP	GENERAL DEFICIENCY IMAGES APPENDIX 5

DEVICE DEFICIENCIES

LOCATION	DESCRIPTION	ADDRESS	DEVICE	MAKE	MODEL	BARCODE	DATE OF TEST	TYPE	IMAGES
1st Flr	1st Floor Auditorium Exit	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	1st Flr Auditorium	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									

DEVICE DEFICIENCIES									
LOCATION	DESCRIPTION	ADDRESS	DEVICE	MAKE	MODEL	BARCODE	DATE OF TEST	TYPE	IMAGES
1st Flr	Auditorium Control Room	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium Lobby Exit	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium Lobby Exit	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Auditorium North Hall Exit	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									
1st Flr	Cafeteria	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Cafeteria	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Cafeteria	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Cafeteria	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Cafeteria	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Cafeteria	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Cafeteria	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Cafeteria Entry	—	Horn/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but fails to sound during testing.									
1st Flr	Gym	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									

DEVICE DEFICIENCIES									
LOCATION	DESCRIPTION	ADDRESS	DEVICE	MAKE	MODEL	BARCODE	DATE OF TEST	TYPE	IMAGES
1st Flr	Gym 104B	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym Boys Bathroom	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym Boys locker room	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym Door	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym Door	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym Girls Locker Room	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym Lobby South	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym south	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym South Center	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
1st Flr	Gym Unisex RR	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: Strobe but failure to sound at testing.									
—	Inside FCPS 1	—	Battery	—	—	—	06/05/2025	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.1
FAILURE REASON: Failed Load Test									
—	Inside FCPS 2	—	Battery	—	—	—	06/05/2025	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.2
FAILURE REASON: Failed Load Test									
—	Inside FCPS 3	—	Battery	—	—	—	06/05/2025	FUNCTIONAL FAILURE,VISUAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.3
FAILURE REASON: Failed Load Test and Date exceeded									
—	Inside FCPS 4	—	Battery	—	—	—	06/05/2025	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.4
FAILURE REASON: Failed Load Test									
2nd Flr	In sprinkler closet of boys RR 2nd floor votech	M36	Water Flow Switch	—	—	—	06/06/2025	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.5
FAILURE REASON: Device failed to report to panel at testing. Additionally cover was left off by previous company.									

DEVICE DEFICIENCIES									
LOCATION	DESCRIPTION	ADDRESS	DEVICE	MAKE	MODEL	BARCODE	DATE OF TEST	TYPE	IMAGES
2nd Flr	In sprinkler closet of boys RR 2nd floor Votech	M38	Tamper Switch	—	—	—	06/06/2025	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.6
FAILURE REASON: Device failed to report to panel at testing.									
1st Flr	Men's RR Auditorium	—	Speaker/Strobe	—	—	—	06/06/2025	FUNCTIONAL FAILURE	—
FAILURE REASON: No sound									

INSPECTION RESULTS SUMMARY				
DEVICE TYPE	INVENTORY COUNT	PASSED	FAILED	CANNOT INSPECT
Battery	5	1	4	0
Duct Detector	9	9	0	0
Panel	4	4	0	0
Pull Station	30	30	0	0
Smoke Detector	83	83	0	0
Tamper Switch	1	0	1	0
Water Flow Switch	1	0	1	0
Horn/Strobe	117	109	8	0
Speaker/Strobe	32	6	26	0
Strobe	60	60	0	0
TOTAL	342	302	40	0

Panels/Initiating Devices

INSPECTION RESULTS SUMMARY

DEVICE TYPE	INVENTORY COUNT	PASSED	FAILED	CANNOT INSPECT
Battery	5	1	4	0
Duct Detector	9	9	0	0
Panel	4	4	0	0
Pull Station	30	30	0	0
Smoke Detector	83	83	0	0
Tamper Switch	1	0	1	0
Water Flow Switch	1	0	1	0

NAC PANELS

#	LOCATION	DESCRIPTION	MANUFACTURER	MODEL	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	—	FCPS 1	Honeywell	S2424	Panel	—	Cameron Peterson	06/06/2025	Passed
2	—	FCPS 2	Honeywell	S2424	Panel	—	Cameron Peterson	06/06/2025	Passed
3	—	FCPS 3	Honeywell	S2424	Panel	—	Cameron Peterson	06/06/2025	Passed
4	—	FCPS 4	Honeywell	S2424	Panel	—	Cameron Peterson	06/06/2025	Passed

BATTERIES

#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	1st Flr	Inside Facp	Battery	—	Cameron Peterson	06/05/2025	Passed
Quantity (Enter 2 if answering for a set)							2
Amp hour rating							7ah
Visual inspection							Pass
Has the Alarm Equipment or Battery Manufacturer's Replacement Date Been Exceeded?							Pass
Manufacturer Date Code							12/7/2020
Voltage with charger							27.40
Voltage without charger							27.27
Load Voltage Test							Pass
Load Voltage Test Results (%)							6.4ah
2	—	Inside FCPS 1	Battery	—	Cameron Peterson	06/05/2025	Failed
Quantity (Enter 2 if answering for a set)							2
Amp hour rating							7ah
Visual inspection							Pass
Has the Alarm Equipment or Battery Manufacturer's Replacement Date Been Exceeded?							Pass
Manufacturer Date Code							3/4/22
Voltage with charger							27.40
Voltage without charger							26.80
Load Voltage Test							Fail
Load Voltage Test Results (%)							Flat Battery
Reason for failure: (Functional Failure) Failed Load Test							

Panels/Initiating Devices

BATTERIES

#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
3	—	Inside FCPS 2	Battery	—	Cameron Peterson	06/05/2025	Failed
Quantity (Enter 2 if answering for a set)							2
Amp hour rating							7ah
Visual inspection							Pass
Has the Alarm Equipment or Battery Manufacturer's Replacement Date Been Exceeded?							Pass
Manufacturer Date Code							3/4/22
Voltage with charger							27.50
Voltage without charger							26.90
Load Voltage Test							Fail
Load Voltage Test Results (%)							Flat Battery
Reason for failure: (Functional Failure) Failed Load Test							
4	—	Inside FCPS 3	Battery	—	Cameron Peterson	06/05/2025	Failed
Quantity (Enter 2 if answering for a set)							2
Amp hour rating							7ah
Visual inspection							Pass
Has the Alarm Equipment or Battery Manufacturer's Replacement Date Been Exceeded?							Fail
Manufacturer Date Code							4/19/18
Voltage with charger							27.66
Voltage without charger							27.20
Load Voltage Test							Pass
Load Voltage Test Results (%)							Flat Battery
Reason for failure: (Functional Failure, Visual Failure) Failed Load Test and Date exceeded							
5	—	Inside FCPS 4	Battery	—	Cameron Peterson	06/05/2025	Failed
Quantity (Enter 2 if answering for a set)							2
Amp hour rating							7ah
Visual inspection							Pass
Has the Alarm Equipment or Battery Manufacturer's Replacement Date Been Exceeded?							Pass
Manufacturer Date Code							3/4/22
Voltage with charger							27.57
Voltage without charger							26.80
Load Voltage Test							Pass
Load Voltage Test Results (%)							Flat Battery
Reason for failure: (Functional Failure) Failed Load Test							

SMOKE DETECTORS

#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	1st Flr	?	1D00	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
2	1st Flr	1st Fl Audit South Lobby	1D031	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
3	1st Flr	1st Fl Cafeteria	1D026	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
4	1st Flr	1st Fl Cafeteria	1D024	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed

Panels/Initiating Devices

SMOKE DETECTORS								
#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
5	1st Flr	1st Fl Cafeteria	1D027	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
6	1st Flr	1st Fl Main Lobby S	1D020	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
7	1st Flr	1st Fl North Hall Exit	1D029	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
8	1st Flr	1st Flr Annex Entry Hall South	1D040	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
9	1st Flr	1st Flr Annex Entry Hall South	1D039	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
10	1st Flr	1st Flr Annex N Hall W	1D056	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
11	1st Flr	1st Flr Annex N Hall W	1D055	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
12	—	1st Flr Annex S Hall W	1D047	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
13	—	1st Flr Annex S Hall W	1D048	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
14	—	1st Flr Annex S Hall W	1D046	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
15	1st Flr	1st Flr Annex South Stairwell	1D045	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
16	1st Flr	1st Flr Annex South Stairwell	1D041	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
17	1st Flr	1st Flr Annex South Stairwell	1D050	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
18	1st Flr	1st Flr Annex South Stairwell	1D046	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
19	1st Flr	1st Flr Annex South Stairwell	1D049	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
20	1st Flr	1st Flr Annex South Stairwell	1D053	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
21	1st Flr	1st Flr Annex South Stairwell	1D051	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
22	1st Flr	1st Flr Annex South Stairwell	1D051	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
23	1st Flr	1st Flr Audit Hall	1D135	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
24	1st Flr	1st Flr Auditorium N Hall	1D136	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
25	1st Flr	1st Flr Auditorium N Lobby	1D033	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
26	1st Flr	1st Flr Auditorium N Lobby	1D034	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
27	1st Flr	1st Flr Audit South Lobby	1D032	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
28	1st Flr	1st Flr Main Elev Lobby	1D013	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
29	1st Flr	1st Flr Main Lobby	1D012	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
30	1st Flr	1st Flr Main Lobby	1D015	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
31	1st Flr	1st Flr Main Lobby N	1D025	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
32	1st Flr	1st Flr Main Lobby N. Hall	1D016	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed

Panels/Initiating Devices

SMOKE DETECTORS								
#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
33	1st Flr	1st Flr Main Lobby North	1D018	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
34	1st Flr	1st Flr Main Lobby North	1D019	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
35	1st Flr	1st Flr Main Lobby S	1D022	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
36	1st Flr	1st Flr Main Lobby S	1D021	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
37	1st Flr	1st Flr Main Lobby S	1D003	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
38	1st Flr	1st Flr N Hall Exit	1D029	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
39	1st Flr	1st Flr North Hall	1D017	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
40	1st Flr	1st Flr North Hall	1D017	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
41	1st Flr	1st Flr S Hall E Stair A109A	1D007	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
42	—	1st Flr South Hall	1D004	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
43	1st Flr	1st Flr Stair A-2	1D115	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
44	1st Flr	1st Flr Stair A-2	1D115	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
45	1st Flr	1st Flr Stair A-3	1D116	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
46	1st Flr	1st Flr Stairway A-3	1D139	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
47	—	2nd Flr Main Elev	2D074	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
48	—	2nd Flr Annex N Hall W	1D105	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
49	—	2nd Flr Annex N Hall West	1D106	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
50	—	2nd Flr Annex South Hall	1D097	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
51	—	2nd Flr Annex South Hall	1D102	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
52	—	2nd Flr Annex South Hall	1D095	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
53	—	2nd Flr Annex South Hall	1D096	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
54	—	2nd Flr Annex South Hall	1D101	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
55	—	2nd Flr Annex South Hall	1D103	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
56	—	2nd Flr Annex South Hall East	1D100	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
57	—	2nd Flr Annex South Hall East	1D099	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
58	—	2nd Flr Annex South Hall East	1D104	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
59	—	2nd Flr Annex South Stair V-1	1D094	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
60	—	2nd Flr Annex South Stair V-1	1D093	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
61	—	2nd Flr Main Lobby	2D076	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
62	—	2nd Flr Main Lobby N	2D083	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed

Panels/Initiating Devices

SMOKE DETECTORS								
#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
63	—	2nd Flr Main Lobby N	2D085	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
64	—	2nd Flr Main Lobby N	2D081	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
65	—	2nd Flr Main Lobby N	2D080	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
66	—	2nd Flr Main Lobby N Hall	2D077	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
67	—	2nd Flr Main Lobby S	2D087	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
68	—	2nd Flr Main Lobby S	2D088	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
69	—	2nd Flr Main Lobby S	2D086	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
70	—	2nd Flr Main Lobby S	2D072	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
71	—	2nd Flr Main Lobby S Hall	2D070	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
72	—	2nd Flr S Hall	2D069	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
73	—	2nd Flr South Hall Stair A-1	2D068	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
74	—	2nd Flr South Hall Stair A-1	2D066	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
75	—	2nd Flr Stair A-2	2D130	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
76	1st Flr	Auditorium Hallway	1D124	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
77	1st Flr	Auditorium Lobby	1D119	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
78	1st Flr	Auditorium Lobby	1D124	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
79	1st Flr	Audit South Lobby	1D118	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
80	—	Main Lobby	2D072	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
81	—	Main Lobby S	2D071	Smoke Detector	—	Cameron Peterson	06/06/2025	Passed
82	1st Flr	Main Office Elec. Rm	1D002	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed
83	1st Flr	Smoke Above Facp	1D001	Smoke Detector	—	Cameron Peterson	06/05/2025	Passed

DUCT DETECTORS								
#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	—	2nd Flr Annex Rm B233	1D137	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
2	—	2nd Flr Atrium South	2D142	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
3	—	2nd Flr Vo-tech	1D134	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
4	—	2nd Flr Vo-tech	1D133	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
5	—	Auditorium Lobby	—	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
6	—	Auditorium Lobby	—	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
7	—	Auditorium Lobby	—	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
8	—	By A212	2D113	Duct Detector	—	Cameron Peterson	06/06/2025	Passed
9	—	By A212	2D143	Duct Detector	—	Cameron Peterson	06/06/2025	Passed

Panels/Initiating Devices

PULL STATIONS								
#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	1st Flr	1st Fl Cafeteria S Exit C-109	1M025	Pull Station	—	Cameron Peterson	06/05/2025	Passed
2	1st Flr	1st Fl Gym S Exit	1M011	Pull Station	—	Cameron Peterson	06/05/2025	Passed
3	1st Flr	1st Fl Kitchen Exit C-109A	1M027	Pull Station	—	Cameron Peterson	06/05/2025	Passed
4	1st Flr	1st Flr Annex Science Lab V -142	1M051	Pull Station	—	Cameron Peterson	06/05/2025	Passed
5	1st Flr	1st Flr Annex W Hall S Exit	1M061	Pull Station	—	Cameron Peterson	06/05/2025	Passed
6	1st Flr	1st Flr Auditorium Hall Exit	1M029	Pull Station	—	Cameron Peterson	06/05/2025	Passed
7	1st Flr	1st Flr Auditorium Lobby Exit	1M031	Pull Station	—	Cameron Peterson	06/05/2025	Passed
8	1st Flr	1st Flr Auditorium Lobby Exit	1M030	Pull Station	—	Cameron Peterson	06/05/2025	Passed
9	1st Flr	1st Flr Auditorium Stage Exit	1M040	Pull Station	—	Cameron Peterson	06/05/2025	Passed
10	1st Flr	1st Flr Gym Lobby N Exit	1M014	Pull Station	—	Cameron Peterson	06/05/2025	Passed
11	1st Flr	1st Flr Gym Lobby S Exit	1M013	Pull Station	—	Cameron Peterson	06/05/2025	Passed
12	1st Flr	1st Flr Lobby SW Exit	1M024	Pull Station	—	Cameron Peterson	06/05/2025	Passed
13	1st Flr	1st Flr Main Entrance	1M002	Pull Station	—	Cameron Peterson	06/05/2025	Passed
14	1st Flr	1st Flr Main Entrance	1M003	Pull Station	—	Cameron Peterson	06/05/2025	Passed
15	1st Flr	1st Flr North Hall Stairs A-2	1M028	Pull Station	—	Cameron Peterson	06/05/2025	Passed
16	1st Flr	1st Flr South Hall E Exit	1M008	Pull Station	—	Cameron Peterson	06/05/2025	Passed
17	1st Flr	1st Flr South Hall W Exit	1M009	Pull Station	—	Cameron Peterson	06/05/2025	Passed
18	—	2nd Flr Annex East Exit	1M072	Pull Station	—	Cameron Peterson	06/06/2025	Passed
19	—	2nd Flr Annex North Hall	1M073	Pull Station	—	Cameron Peterson	06/06/2025	Passed
20	—	2nd Flr Annex South Hall Exit	1M071	Pull Station	—	Cameron Peterson	06/06/2025	Passed
21	—	2nd Flr Annex W Stair V-2	1M074	Pull Station	—	Cameron Peterson	06/06/2025	Passed
22	—	2nd Flr Library/Mech Hall	2M066	Pull Station	—	Cameron Peterson	06/06/2025	Passed
23	—	2nd Flr N Hall Stairs	2M068	Pull Station	—	Cameron Peterson	06/06/2025	Passed
24	—	2nd Flr South Hall Stair A-1	2M064	Pull Station	—	Cameron Peterson	06/06/2025	Passed
25	—	Annex S Hall W	1M046	Pull Station	—	Cameron Peterson	06/06/2025	Passed
26	1st Flr	Auditorium Exit	1M032	Pull Station	—	Cameron Peterson	06/05/2025	Passed
27	1st Flr	Auditorium Exit	1M033	Pull Station	—	Cameron Peterson	06/05/2025	Passed
28	1st Flr	Auditorium N Hall Exit	1M034	Pull Station	—	Cameron Peterson	06/05/2025	Passed

Panels/Initiating Devices

PULL STATIONS

#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
29	1st Flr	Gym Basement Rm Gb-02	1M023	Pull Station	—	Cameron Peterson	06/05/2025	Passed
30	1st Flr	Gym Basement west Hall exit	1M022	Pull Station	—	Cameron Peterson	06/05/2025	Passed

WATER FLOW DEVICES

#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	2nd Flr	In sprinkler closet of boys RR 2nd floor votech	M36	Water Flow Switch	—	John Hickman	06/06/2025	Failed

Reason for failure: (Functional Failure) Device failed to report to panel at testing. Additionally cover was left off by previous company.

SPRINKLER DEVICES

#	LOCATION	DESCRIPTION	ADDRESS	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	2nd Flr	In sprinkler closet of boys RR 2nd floor Votech	M38	Tamper Switch	—	John Hickman	06/06/2025	Failed

Reason for failure: (Functional Failure) Device failed to report to panel at testing.

Notification Devices

INSPECTION RESULTS SUMMARY

DEVICE TYPE	INVENTORY COUNT	PASSED	FAILED	CANNOT INSPECT
Horn/Strobe	117	109	8	0
Speaker/Strobe	32	6	26	0
Strobe	60	60	0	0

AUDIBLE VISIBLE DEVICES W/DB

#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	1st Flr	1st Floor Annex Electrical Room V153	Horn/Strobe	—	John Hickman	06/06/2025	Passed
2	1st Flr	1st Floor Annex Science Lab	Horn/Strobe	—	John Hickman	06/06/2025	Passed
3	1st Flr	1st Floor Annex Science Lab	Horn/Strobe	—	John Hickman	06/06/2025	Passed
4	1st Flr	1st Floor Annex West Hall South Exit	Horn/Strobe	—	John Hickman	06/06/2025	Passed
5	1st Flr	1st Floor Auditorium Exit	Horn/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
6	1st Flr	1st Floor Main Lobby	Horn/Strobe	—	John Hickman	06/06/2025	Passed
7	1st Flr	1st Floor North Hall East Stair	Horn/Strobe	—	John Hickman	06/06/2025	Passed
8	1st Flr	1st Floor North Hall Exit	Horn/Strobe	—	John Hickman	06/06/2025	Passed
9	1st Flr	1st Floor Stairs A3	Horn/Strobe	—	John Hickman	06/06/2025	Passed
10	1st Flr	1st Floor West Hall	Horn/Strobe	—	John Hickman	06/06/2025	Passed
11	2nd Flr	2nd Floor Annex North Hall Exit	Horn/Strobe	—	John Hickman	06/06/2025	Passed
12	2nd Flr	2nd Floor Library Mech Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
13	2nd Flr	2nd Floor Main Lobby North	Horn/Strobe	—	John Hickman	06/06/2025	Passed
14	2nd Flr	2nd Floor Main Lobby North	Horn/Strobe	—	John Hickman	06/06/2025	Passed
15	2nd Flr	2nd Floor Main Lobby South	Horn/Strobe	—	John Hickman	06/06/2025	Passed
16	2nd Flr	2nd Floor Main Lobby South	Horn/Strobe	—	John Hickman	06/06/2025	Passed
17	2nd Flr	2nd Floor South Hall	Horn/Strobe	—	John Hickman	06/06/2025	Passed
18	2nd Flr	A214	Horn/Strobe	—	John Hickman	06/06/2025	Passed
19	2nd Flr	A216	Horn/Strobe	—	John Hickman	06/06/2025	Passed
20	2nd Flr	A218 inside	Horn/Strobe	—	John Hickman	06/06/2025	Passed
21	2nd Flr	A218 outside	Horn/Strobe	—	John Hickman	06/06/2025	Passed
22	2nd Flr	A218 Outside	Horn/Strobe	—	John Hickman	06/06/2025	Passed
23	2nd Flr	A231	Horn/Strobe	—	John Hickman	06/06/2025	Passed
24	1st Flr	Annex Entry Hall South	Horn/Strobe	—	John Hickman	06/06/2025	Passed
25	1st Flr	Annex Room V134	Horn/Strobe	—	John Hickman	06/06/2025	Passed

Notification Devices

AUDIBLE VISIBLE DEVICES W/DB							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
26	1st Flr	Annex Room V136	Horn/Strobe	—	John Hickman	06/06/2025	Passed
27	2nd Flr	Annex South Exit	Horn/Strobe	—	John Hickman	06/06/2025	Passed
28	1st Flr	Annex South Hall Exit	Horn/Strobe	—	John Hickman	06/06/2025	Passed
29	1st Flr	Annex South Hall West	Horn/Strobe	—	John Hickman	06/06/2025	Passed
30	1st Flr	Annex V-132A	Horn/Strobe	—	John Hickman	06/06/2025	Passed
31	1st Flr	Auditorium Lobby Exit	Horn/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
32	1st Flr	Auditorium Lobby Exit	Horn/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
33	1st Flr	Auditorium North Hall Exit	Horn/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
34	2nd Flr	B230	Horn/Strobe	—	John Hickman	06/06/2025	Passed
35	2nd Flr	B231	Horn/Strobe	—	John Hickman	06/06/2025	Passed
36	2nd Flr	B234	Horn/Strobe	—	John Hickman	06/06/2025	Passed
37	2nd Flr	B235	Horn/Strobe	—	John Hickman	06/06/2025	Passed
38	1st Flr	Boys Restroom	Horn/Strobe	—	John Hickman	06/06/2025	Passed
39	1st Flr	Boys Restroom V155	Horn/Strobe	—	John Hickman	06/06/2025	Passed
40	2nd Flr	Boys RR	Horn/Strobe	—	John Hickman	06/06/2025	Passed
41	2nd Flr	Boys RR	Horn/Strobe	—	John Hickman	06/06/2025	Passed
42	1st Flr	Break Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
43	1st Flr	Cafeteria	Horn/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
44	1st Flr	Cafeteria	Horn/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
45	1st Flr	Cafeteria	Horn/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
46	1st Flr	Cafeteria Entry	Horn/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
47	1st Flr	Choir Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
48	1st Flr	Choir Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
49	1st Flr	Choir Room 2	Horn/Strobe	—	John Hickman	06/06/2025	Passed
50	1st Flr	Choir Room 2	Horn/Strobe	—	John Hickman	06/06/2025	Passed
51	1st Flr	Classroom V131	Horn/Strobe	—	John Hickman	06/06/2025	Passed
52	1st Flr	Classroom V131 Outside	Horn/Strobe	—	John Hickman	06/06/2025	Passed
53	1st Flr	Clinic	Horn/Strobe	—	John Hickman	06/06/2025	Passed
54	1st Flr	Clinic	Horn/Strobe	—	John Hickman	06/06/2025	Passed

Notification Devices

AUDIBLE VISIBLE DEVICES W/DB							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
55	1st Flr	Exam Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
56	1st Flr	Exam Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
57	1st Flr	Exam Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
58	2nd Flr	Girls RR	Horn/Strobe	—	John Hickman	06/06/2025	Passed
59	2nd Flr	Inside A204	Horn/Strobe	—	John Hickman	06/06/2025	Passed
60	2nd Flr	ISS A ROOM	Horn/Strobe	—	John Hickman	06/06/2025	Passed
61	2nd Flr	Iss b Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
62	2nd Flr	L209	Horn/Strobe	—	John Hickman	06/06/2025	Passed
63	2nd Flr	L209A	Horn/Strobe	—	John Hickman	06/06/2025	Passed
64	2nd Flr	L209D	Horn/Strobe	—	John Hickman	06/06/2025	Passed
65	1st Flr	Lab V143	Horn/Strobe	—	John Hickman	06/06/2025	Passed
66	2nd Flr	Library	Horn/Strobe	—	John Hickman	06/06/2025	Passed
67	2nd Flr	Library	Horn/Strobe	—	John Hickman	06/06/2025	Passed
68	1st Flr	Lobby Southwest Exit	Horn/Strobe	—	John Hickman	06/06/2025	Passed
69	1st Flr	Main Lobby South	Horn/Strobe	—	John Hickman	06/06/2025	Passed
70	1st Flr	Main Office Outside	Horn/Strobe	—	John Hickman	06/06/2025	Passed
71	2nd Flr	Outside A204	Horn/Strobe	—	John Hickman	06/06/2025	Passed
72	2nd Flr	Outside A212	Horn/Strobe	—	John Hickman	06/06/2025	Passed
73	1st Flr	Outside Restroom	Horn/Strobe	—	John Hickman	06/06/2025	Passed
74	1st Flr	Outside Room 112A	Horn/Strobe	—	John Hickman	06/06/2025	Passed
75	1st Flr	Outside Room 113A	Horn/Strobe	—	John Hickman	06/06/2025	Passed
76	2nd Flr	Outside Room 234	Horn/Strobe	—	John Hickman	06/06/2025	Passed
77	2nd Flr	Outside V239	Horn/Strobe	—	John Hickman	06/06/2025	Passed
78	1st Flr	Outside Vocation Office	Horn/Strobe	—	John Hickman	06/06/2025	Passed
79	2nd Flr	Room A200	Horn/Strobe	—	John Hickman	06/06/2025	Passed
80	1st Flr	Room B131	Horn/Strobe	—	John Hickman	06/06/2025	Passed
81	1st Flr	SBE Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
82	1st Flr	SBE Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
83	1st Flr	Sheriff's Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
84	1st Flr	South Hall East Exit	Horn/Strobe	—	John Hickman	06/06/2025	Passed
85	1st Flr	Stairs 109A	Horn/Strobe	—	John Hickman	06/06/2025	Passed
86	1st Flr	Stairwell A-3	Horn/Strobe	—	John Hickman	06/06/2025	Passed
87	1st Flr	Student Support Center	Horn/Strobe	—	John Hickman	06/06/2025	Passed
88	1st Flr	Teacher Work Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
89	1st Flr	Trophy Hall	Horn/Strobe	—	John Hickman	06/06/2025	Passed

Notification Devices

AUDIBLE VISIBLE DEVICES W/DB							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
90	1st Flr	Trophy Hall	Horn/Strobe	—	John Hickman	06/06/2025	Passed
91	1st Flr	V132A	Horn/Strobe	—	John Hickman	06/06/2025	Passed
92	1st Flr	V132A	Horn/Strobe	—	John Hickman	06/06/2025	Passed
93	1st Flr	V132C	Horn/Strobe	—	John Hickman	06/06/2025	Passed
94	1st Flr	V132J	Horn/Strobe	—	John Hickman	06/06/2025	Passed
95	1st Flr	V135	Horn/Strobe	—	John Hickman	06/06/2025	Passed
96	1st Flr	V136	Horn/Strobe	—	John Hickman	06/06/2025	Passed
97	1st Flr	V141	Horn/Strobe	—	John Hickman	06/06/2025	Passed
98	1st Flr	V142	Horn/Strobe	—	John Hickman	06/06/2025	Passed
99	1st Flr	V144	Horn/Strobe	—	John Hickman	06/06/2025	Passed
100	1st Flr	V149	Horn/Strobe	—	John Hickman	06/06/2025	Passed
101	1st Flr	V149	Horn/Strobe	—	John Hickman	06/06/2025	Passed
102	1st Flr	V150 Inside Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
103	1st Flr	V150 Inside Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
104	2nd Flr	V234	Horn/Strobe	—	John Hickman	06/06/2025	Passed
105	2nd Flr	V234	Horn/Strobe	—	John Hickman	06/06/2025	Passed
106	2nd Flr	V234 Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
107	2nd Flr	V236	Horn/Strobe	—	John Hickman	06/06/2025	Passed
108	2nd Flr	V236	Horn/Strobe	—	John Hickman	06/06/2025	Passed
109	2nd Flr	V237	Horn/Strobe	—	John Hickman	06/06/2025	Passed
110	2nd Flr	V238	Horn/Strobe	—	John Hickman	06/06/2025	Passed
111	2nd Flr	V239	Horn/Strobe	—	John Hickman	06/06/2025	Passed
112	2nd Flr	V239	Horn/Strobe	—	John Hickman	06/06/2025	Passed
113	2nd Flr	V246 room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
114	2nd Flr	V249 Room	Horn/Strobe	—	John Hickman	06/06/2025	Passed
115	2nd Flr	V250	Horn/Strobe	—	John Hickman	06/06/2025	Passed
116	2nd Flr	V252 Outside	Horn/Strobe	—	John Hickman	06/06/2025	Passed
117	1st Flr	Vocation Office Kitchen	Horn/Strobe	—	John Hickman	06/06/2025	Passed

DEVICES							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
1	1st Flr	1st Flr Auditorium	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
2	1st Flr	110 A	Strobe	—	John Hickman	06/06/2025	Passed
3	1st Flr	110 B	Strobe	—	John Hickman	06/06/2025	Passed

Notification Devices

DEVICES							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
4	1st Flr	110 C	Strobe	—	John Hickman	06/06/2025	Passed
5	1st Flr	110 C Inside	Strobe	—	John Hickman	06/06/2025	Passed
6	1st Flr	110 C RR	Strobe	—	John Hickman	06/06/2025	Passed
7	1st Flr	110 D	Strobe	—	John Hickman	06/06/2025	Passed
8	1st Flr	112A	Strobe	—	John Hickman	06/06/2025	Passed
9	1st Flr	112C	Strobe	—	John Hickman	06/06/2025	Passed
10	1st Flr	113A	Strobe	—	John Hickman	06/06/2025	Passed
11	1st Flr	114A	Strobe	—	John Hickman	06/06/2025	Passed
12	1st Flr	114B	Strobe	—	John Hickman	06/06/2025	Passed
13	1st Flr	114C	Strobe	—	John Hickman	06/06/2025	Passed
14	1st Flr	A108	Strobe	—	John Hickman	06/06/2025	Passed
15	1st Flr	A108	Strobe	—	John Hickman	06/06/2025	Passed
16	2nd Flr	A206	Strobe	—	John Hickman	06/06/2025	Passed
17	2nd Flr	A208 Room	Speaker/Strobe	—	John Hickman	06/06/2025	Passed
18	1st Flr	Admin office Rm A100B	Strobe	—	John Hickman	06/06/2025	Passed
19	1st Flr	Auditorium	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
20	1st Flr	Auditorium	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
21	1st Flr	Auditorium	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
22	1st Flr	Auditorium	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
23	1st Flr	Auditorium	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
24	1st Flr	Auditorium Control Room	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
25	2nd Flr	B231	Strobe	—	John Hickman	06/06/2025	Passed
26	2nd Flr	B231	Strobe	—	John Hickman	06/06/2025	Passed
27	2nd Flr	B233	Strobe	—	John Hickman	06/06/2025	Passed
28	1st Flr	Boys Girls Restroom	Speaker/Strobe	—	John Hickman	06/06/2025	Passed
29	1st Flr	Boys RR	Strobe	—	John Hickman	06/06/2025	Passed
30	1st Flr	Boys RR	Strobe	—	John Hickman	06/06/2025	Passed
31	1st Flr	Boys RR	Strobe	—	John Hickman	06/06/2025	Passed
32	1st Flr	Boys RR	Strobe	—	John Hickman	06/06/2025	Passed
33	2nd Flr	Boys RR	Strobe	—	John Hickman	06/06/2025	Passed

Notification Devices

DEVICES							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
34	1st Flr	Boys RR	Strobe	—	John Hickman	06/06/2025	Passed
35	1st Flr	Boys RR In V155	Strobe	—	John Hickman	06/06/2025	Passed
36	1st Flr	Cafeteria	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
37	1st Flr	Cafeteria	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
38	1st Flr	Cafeteria	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
39	1st Flr	Cafeteria	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
40	1st Flr	Cafeteria	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but fails to sound during testing.							
41	1st Flr	Classroom V133 Inside	Strobe	—	John Hickman	06/06/2025	Passed
42	1st Flr	D134B	Strobe	—	John Hickman	06/06/2025	Passed
43	2nd Flr	Freshman's Office	Strobe	—	John Hickman	06/06/2025	Passed
44	1st Flr	Girls RR	Strobe	—	John Hickman	06/06/2025	Passed
45	1st Flr	Girls RR	Strobe	—	John Hickman	06/06/2025	Passed
46	1st Flr	Girls RR	Strobe	—	John Hickman	06/06/2025	Passed
47	1st Flr	Girls RR	Strobe	—	John Hickman	06/06/2025	Passed
48	2nd Flr	Girls RR	Strobe	—	John Hickman	06/06/2025	Passed
49	1st Flr	Gym	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
50	1st Flr	Gym	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
51	1st Flr	Gym	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
52	1st Flr	Gym 104B	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
53	1st Flr	Gym Boys Bathroom	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
54	1st Flr	Gym Boys locker room	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
55	1st Flr	Gym Door	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
56	1st Flr	Gym Door	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
57	1st Flr	Gym Girls Locker Room	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							

Notification Devices

DEVICES							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
58	1st Flr	Gym Lobby South	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
59	1st Flr	Gym south	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
60	1st Flr	Gym South Center	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
61	1st Flr	Gym Unisex RR	Speaker/Strobe	—	John Hickman	06/06/2025	Failed
Reason for failure: (Functional Failure) Strobe but failure to sound at testing.							
62	1st Flr	Kitchen	Speaker/Strobe	—	John Hickman	06/06/2025	Passed
63	1st Flr	Kitchen	Speaker/Strobe	—	John Hickman	06/06/2025	Passed
64	1st Flr	Kitchen	Speaker/Strobe	—	John Hickman	06/06/2025	Passed
65	1st Flr	Main office	Strobe	—	John Hickman	06/06/2025	Passed
66	1st Flr	Main office	Strobe	—	John Hickman	06/06/2025	Passed
67	1st Flr	Main Office	Strobe	—	John Hickman	06/06/2025	Passed
68	1st Flr	Men's RR	Strobe	—	John Hickman	06/06/2025	Passed
69	1st Flr	Men's RR	Strobe	—	John Hickman	06/06/2025	Passed
70	1st Flr	Men's RR 131B	Strobe	—	John Hickman	06/06/2025	Passed
71	1st Flr	Men's RR Auditorium	Speaker/Strobe	—	Cameron Peterson	06/06/2025	Failed
Reason for failure: (Functional Failure) No sound							
72	2nd Flr	Office Rm V238	Strobe	—	John Hickman	06/06/2025	Passed
73	1st Flr	Office RR	Strobe	—	John Hickman	06/06/2025	Passed
74	1st Flr	Outside side Office	Strobe	—	John Hickman	06/06/2025	Passed
75	2nd Flr	Outside V246	Strobe	—	John Hickman	06/06/2025	Passed
76	2nd Flr	Rm A201	Strobe	—	John Hickman	06/06/2025	Passed
77	1st Flr	Rm V155	Strobe	—	John Hickman	06/06/2025	Passed
78	1st Flr	RR in Clinic	Strobe	—	John Hickman	06/06/2025	Passed
79	1st Flr	V132 B	Strobe	—	John Hickman	06/06/2025	Passed
80	1st Flr	V132C	Strobe	—	John Hickman	06/06/2025	Passed
81	1st Flr	V149 Storage	Strobe	—	John Hickman	06/06/2025	Passed
82	1st Flr	V155A	Strobe	—	John Hickman	06/06/2025	Passed
83	2nd Flr	V234 Rm	Strobe	—	John Hickman	06/06/2025	Passed
84	2nd Flr	V238B room	Strobe	—	John Hickman	06/06/2025	Passed
85	2nd Flr	V238 Rm	Strobe	—	John Hickman	06/06/2025	Passed
86	1st Flr	Vocational Office	Strobe	—	John Hickman	06/06/2025	Passed
87	1st Flr	Vocational Office Men's RR	Strobe	—	John Hickman	06/06/2025	Passed

Notification Devices

DEVICES							
#	LOCATION	DESCRIPTION	DEVICE TYPE	BARCODE	INSPECTOR	DATE OF TEST	RESULT
88	1st Flr	Vocational Office womens RR	Strobe	—	John Hickman	06/06/2025	Passed
89	1st Flr	Women's RR	Speaker/Strobe	—	John Hickman	06/06/2025	Passed
90	1st Flr	Women's RR	Strobe	—	John Hickman	06/06/2025	Passed
91	1st Flr	Women's RR	Strobe	—	John Hickman	06/06/2025	Passed
92	1st Flr	Women's RR 131B	Strobe	—	John Hickman	06/06/2025	Passed

Inspector Signature _____ 	Inspector Name _____ Cameron Peterson _____ Date _____ 07/07/2025 _____
Signature of the Annual inspection _____ 	Printed name of the Annual inspection _____ Cameron Peterson _____ Date _____ 07/07/2025 _____

Terms And Conditions


- 1. Limitation of Liability; Limitations Of Remedy.** It is understood and agreed by the Customer that Company is not an insurer and that insurance coverage, if any, shall be obtained by the Customer and that amounts payable to Company hereunder are based upon the value of the services and the scope of liability set forth in this agreement and are unrelated to the value of the Customer's property and the property of others located on the premises. Customer agrees to look exclusively to the Customer's insurer to recover for injuries or damage in the event of any loss or injury and that Customer releases and waives all right of recovery against Company arising by way of subrogation. Company makes no guaranty or Warranty, including any implied warranty of merchantability or fitness for a particular purpose that equipment or services supplied by Company will detect or avert occurrences or the consequences there from that the equipment or service was designed to detect or avert. It is impractical and extremely difficult to fix the actual damages, if any, which may proximately result from failure on the part of Company to perform any of its obligations under this agreement. Accordingly, Customer agrees that, Company shall be exempt from liability for any loss, damage or injury arising directly or indirectly from occurrences, or the consequences therefrom, which the equipment or service was designed to detect or avert. Should Company be found liable for any loss, damage or injury arising from a failure of the equipment or service in any respect, Company's liability shall be limited to an amount equal to the agreement price (as increased by the price for any additional work) or where the time and material payment term is selected, Customer's time and material payments to Company. Where this agreement covers multiple sites, liability shall be limited to the amount of the payments allocable to the site where the incident occurred. Such sum shall be complete and exclusive. If Customer desires Company to assume greater liability, the parties shall amend this agreement by attaching a rider setting forth the amount of additional liability and the additional amount payable by the Customer for the assumption by Company of such greater liability, provided however that such rider shall in no way be interpreted to hold Company as an insurer. IN NO EVENT SHALL COMPANY BE LIABLE FOR ANY DAMAGE, LOSS, INJURY, OR ANY OTHER CLAIM ARISING FROM ANY SERVICING, ALTERATIONS, MODIFICATIONS, CHANGES, OR MOVEMENTS OF THE COVERED SYSTEM(S) OR ANY OF ITS COMPONENT PARTS BY THE CUSTOMER OR ANY THIRD PARTY. COMPANY SHALL NOT BE LIABLE FOR INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OF ANY KIND, INCLUDING BUT NOT LIMITED TO DAMAGES ARISING FROM THE USE, LOSS OF THE USE, PERFORMANCE, OR FAILURE OF THE COVERED SYSTEM(S) TO PERFORM. The limitations of liability set forth in this agreement shall inure to the benefit of all parents, subsidiaries and affiliates of Company, whether direct or indirect, Company's employees, agents, officers and directors.
- 2. Limited Warranty.** COMPANY WARRANTS THAT ITS WORKMANSHIP AND MATERIAL FURNISHED UNDER THIS AGREEMENT WILL BE FREE FROM DEFECTS FOR A PERIOD OF NINETY (90) DAYS FROM THE DATE OF FURNISHING. Where Company provides product or equipment of others, Company will warrant the product or equipment only to the extent warranted by such third party. EXCEPT AS EXPRESSLY SET FORTH HEREIN, COMPANY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE WITH RESPECT TO THE SERVICES PERFORMED OR THE PRODUCTS, SYSTEMS OR EQUIPMENT, IF ANY, SUPPORTED HEREUNDER. COMPANY MAKES NO WARRANTY OR REPRESENTATION, AND UNDERTAKES NO OBLIGATION TO ENSURE BY THE SERVICES PERFORMED UNDER THIS AGREEMENT, THAT COMPANY'S PRODUCTS OR THE SYSTEMS OR EQUIPMENT OF THE CUSTOMER WILL CORRECTLY HANDLE THE PROCESSING OF CALENDAR DATES BEFORE OR AFTER DECEMBER 31, 1999.
- 3. Indemnity.** Customer agrees to indemnify, hold harmless and defend Company against any and all losses, damages, costs, including expert fees and costs, and expenses including reasonable defense costs, arising from any and all third party claims for personal injury, death, property damage or economic loss, including specifically any damages resulting from the exposure of workers to Hazardous Conditions whether or not Customer pre-notifies Company of the existence of said hazardous conditions, arising in any way from any act or omission of Customer or Company relating in any way to this agreement, including but not limited to the Services under this agreement, whether such claims are based upon contract, warranty, tort (including but not limited to active or passive negligence), strict liability or otherwise. Company reserves the right to select counsel to represent it in any such action.
- 4. Hazardous Materials.** Customer represents that, except to the extent that Company has been given written notice of the following hazards prior to the execution of this agreement, to the best of Customer's knowledge there is no:
 - a. "permit confined space," as defined by OSHA, or space in which work must be performed that, because of its construction, location, contents or work activity therein, accumulation of a hazardous gas, vapour, dust or fume or the creation of a risk of infectious disease
 - b. need for air monitoring, respiratory protection, or other medical risk
 - c. asbestos, asbestos-containing material, formaldehyde or other potentially toxic or otherwise hazardous material contained in or on the surface of the floors, walls, ceilings, insulation or other structural components of the area of any building
 - d. All of the above are hereinafter referred to as "Hazardous Conditions". Company shall have the right to rely on the representations listed above. If hazardous conditions are encountered by Company during the course of Company's work, the discovery of such conditions shall constitute an event beyond Company's control and Company shall have no obligation to further perform in the area where the hazardous conditions exist until the area has been made safe by Customer as certified in writing by an independent testing agency, and Customer shall pay disruption expenses and re-mobilization expenses as determined by Company. This agreement does not provide for the cost of capture, containment or disposal of any hazardous waste materials, or hazardous materials, encountered in any of the Covered System(s) and/or during performance of the Services. Said materials shall at all times remain the responsibility and property of Customer. Company shall not be responsible for the testing, removal or disposal of such hazardous materials.
- 5. Equipment Disconnections.** This represents Company's notice to you that the system(s)/device(s) listed on the face of this agreement as temporarily or permanently disconnected are no longer in service and, thus, cannot detect, perform and/or report
- 6. General.** Unless otherwise specified, work shall be performed during company's regular business hours,, exclusive of Saturdays, Sundays and Company holidays. All work is subject to review and rebilling in accordance with the terms and conditions of Customer's agreement/contract with Company, if one is in effect. Company shall not be responsible for failure to render services due to causes beyond its control, including but not limited to material shortages, work stoppages, fires, civil disobedience or unrest, severe weather, fire or any other cause beyond the control of Company. Customer is aware that the Limitation of Liability and other provisions set forth in any existing agreement/contract, if one is in effect, or set forth above, apply to services performed and materials supplied. The terms of this agreement shall govern notwithstanding any inconsistent or additional terms and conditions in any purchase order or other document submitted by Customer.

GENERAL DEFICIENCY IMAGES APPENDIX

5 Existing troubles on panel. Trouble smoke photo, second floor south hall 2D067 Trouble First floor south Hall West smoke stair 109A 1D008 Trouble supervisory duct HEND supply dirty 1D109 Trouble smoke beam atrium smoke beam 2D082 Trouble smoke first floor Café entry. 1D023	GENERAL DEFICIENCY IMAGES APPENDIX 1
	
Duct detector seen by CR V250 dangling from ceiling. Existing issue.	GENERAL DEFICIENCY IMAGES APPENDIX 2
	
Smoke detector D008 failed at testing. Additionally this device shows no activity at light.	GENERAL DEFICIENCY IMAGES APPENDIX 3
	

Smoke detector D067 failed at testing. Additionally the device shows no activity at the light.	GENERAL DEFICIENCY IMAGES APPENDIX 4
	
Tested one water flow and one tamper switch per customer request, both failed to report to FACP	GENERAL DEFICIENCY IMAGES APPENDIX 5
	

DEFICIENCY IMAGE APPENDICES

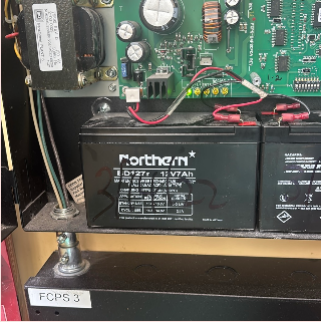LOCATION	DESCRIPTION	DEVICE	BARCODE	TYPE	IMAGES
	Inside FCPS 1	Battery	—	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.1
FAILURE REASON: Failed Load Test					
					
	Inside FCPS 2	Battery	—	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.2
FAILURE REASON: Failed Load Test					
					
	Inside FCPS 3	Battery	—	FUNCTIONAL FAILURE,VISUAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.3
FAILURE REASON: Failed Load Test and Date exceeded					
					


	Inside FCPS 4	Battery	—	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.4
--	---------------	---------	---	--------------------	--------------------------------

FAILURE REASON: Failed Load Test



2nd Flr	In sprinkler closet of boys RR 2nd floor votech	Water Flow Switch	—	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.5
---------	---	-------------------	---	--------------------	--------------------------------

FAILURE REASON: Device failed to report to panel at testing. Additionally cover was left off by previous company.

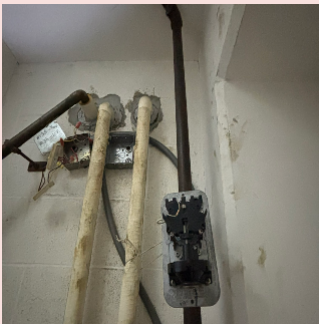

2nd Flr	In sprinkler closet of boys RR 2nd floor Votech	Tamper Switch	—	FUNCTIONAL FAILURE	DEFICIENCY IMAGES APPENDIX 1.6
---------	---	---------------	---	--------------------	--------------------------------

FAILURE REASON: Device failed to report to panel at testing.



DEVICE NOTE IMAGE APPENDICES
